



DIPACO
DIESEL
PARTS
U S A

PRODUCT INFORMATION

FI-48

May 1998

File: Other Fuel

New 6.5L Installation Kits Changes to 6.2L Installation Kits

New 6.5L Installation Kits

General Motors has reported complaints of excessive black smoke during acceleration of the 6.5L turbocharged diesel engine. This complaint usually occurs after engine or fuel system repair. The cause of the black smoke is either lack of installation or improper installation of the 10191428 EGR Tower Gasket. The purpose of the gasket is to seal exhaust gasses from the intake system.



**D10191428 EGR
 Tower Gasket**

DIPACO now has available the **D10191428** EGR Tower Gasket. We have incorporated this gasket into two new installation kits: **DPE65100** 6.5L Pump and Injector Installation Kit and **DPE65110** 6.5L Pump Installation Kit. The **D10191428** EGR Tower Gasket is also available separately. The **D10191428** is installed on top of the intake manifold EGR tower below the intake extension. The metal side of the gasket faces up when it is installed correctly. If your customer has a 6.5L engine, you need to supply him with the appropriate DIPACO 6.5L kit. If your customer is installing injectors only, continue to use the **DPE62120** Injector Installation Kit.

Changes to 6.2L Installation Kits

With the availability of our **DPE65100** and **DPE65110** kits specifically for 6.5L engines, the **D10137537** 6.5L Air Cleaner Gasket has been removed from the **DPE62100** Pump and Injector Installation Kit and the **DPE62110** Pump Installation Kit. As mentioned above, when installing only injectors, in either a 6.2L or 6.5L

The chart below shows the contents of the various DIPACO 6.2L and 6.5L Installation Kits.

Part Number	Description	DPE62100	DPE62110	DPE62120	DPE65100	DPE65110
D10093148	Hose and End Cap Clamp	2		2	2	
D10137537	6.5L Air Cleaner Base Gasket			1	1	1
D10191428	6.5L EGR Tower Gasket				1	1
D14022651	Pump Mount Gasket	1	1		1	1
D14025557	Nozzle Gasket	8		8	8	
D14033942	6.2L Air Cleaner Base Gasket	1	1	1		
D14066301	Nozzle Plug	2		2	2	
D14066305	Hose 9" Length	8		8	8	
DPE91586	Intake Manifold Gasket "Non-stick"	2	2		2	2

ADMINISTRATION
 (775) 329-7511
 (775) 329-9740 Fax
 admin@dipaco.com E-mail

DIPACO, Inc.
 105 East Parr Blvd.
 Reno, Nevada, 89512 • USA
 Internet: www.dipaco.com

SALES
 Toll Free (800) 648-4720
 Toll Free Fax (888) 320-7761
 E-mail sales@dipaco.com